

# SHE Flash Report

To be completed and disseminated within 2 hours of the incident occurring.

**Date:** 21/10/2019

**Approximate Time of Incident:** 17:30

**Project:** W2B

## BRIEF DETAILS OF THE INCIDENT – FACTS ONLY, NO SPECULATION (APPLICABLE TO ALL INCIDENTS)

**Incident Description:** A CPB owned and operated Vehicle Loading Crane VT0673 (HIAB) was overturned while unloading a pallet of steel reinforcing bars. No injuries were sustained

The truck was positioned on concrete pavement without the outriggers extended (short legged). The outriggers were down with the base plates on the concrete pavement.

The load was being placed at approx. 4 meter radius. Adjacent to previously unloading form boards.

The reinforcing bars weighed 1767 Kg plus rigging equipment and timber pallet.

The Operator & Dogger were not qualified to do this task.

There were not any personnel on the ground in the slew zone.

The local area crew had finished work and gone home for the shift.

This unloading of materials was planned by CPB paving supervision.

Workers involved were not affected by alcohol or drugs.



Post event re-enactment showing position of operator during the lift.

**Location:** W2B Project Section 8 at chainage 136500

### Names of Employer/s of workers involved:

CPB – Crane Operator

CPB - Labourer

## IMMEDIATE ACTION TAKEN – (PROVIDE DETAILS OF ANY CORRECTIVE ACTIONS TAKEN AT THE TIME OF THIS REPORT)

Secured scene

Notified Client and Regulator (NSW Worksafe) by telephone

Commenced investigations

Stood down all Vehicle Loading crane operations pending further investigations

Commenced recovery

### Incident Type (more than one can be selected):

Safety & Health     Environment     Rail Safety     Property Damage     Other

Actual     Potential

LTI - NO

Spill - Nil

Discharge - Nil

Noise - NA