

# Serious accidents involving retractable hydraulic access ladders on mobile mining equipment

# Mines safety bulletin no.185 | 26 February 2020

# Background

A serious accident causing the death of a Coal Mine Worker in 2019 has been investigated and the findings will be made available to industry. The findings from this incident investigation and related incidents in Queensland and other states suggests that significant similarities exist across industry, requiring operators to audit their equipment and operating practices to ensure the lessons learnt are not forgotten. This bulletin addresses safety issues involved with three incidents and associated observations:

## **Incident One**

# Death of an excavator operator entangled by excavator access ladder (Central Queensland 2019)

An operator was fatally injured when he became entangled between the movable part of an excavator's access ladder and the wall of the engine room. (See Figure 1).



#### Figure 1 - Excavator with retractable ladder

Authorised by Chief Inspector of Coal Mines | Peter Newman Further information contact: Theo Kahl, Inspector of Mines, +61 7 4936 0127 theo.kahl@dnrme.qld.gov.au **Place alert on noticeboards and ensure relevant people in your organisation receive a copy.** See more safety alerts and bulletins at <u>http://dnrme.qld.gov.au/</u> And the hazard database at <u>https://www.business.qld.gov.au/</u> <u>safety-health/mining-hazards/hazards</u>

© State of Queensland, Department of Natural Resources, Mines and Energy, 2020.

Version 1, 26 February 2020

Follow our updates on





# Findings

There were no witnesses to the incident. It is unknown how he approached Cell A2 where he became entangled (Refer Figure 2). The most likely scenario was he tripped on the upper stairs or mid platform and fell face-forward into the handrails.

While there were several potential scenarios of how he could have become entangled, the evidence and analysis of data from the scene indicated that when he did become entangled, he simultaneously activated the E-Valve positioned behind the rails (Figure 3).

It was identified that the E-Valve could be operated manually in a way not consistent with the requirements of the Original Equipment Manufacturer (OEM) operating manual. In addition, the valve could be rotated directly as well as by a pull cable installed for that purpose.

For routine lowering of the ladder, a set of controls, requiring operation with two hands, was positioned a few metres away from the hazard on the mid stairs landing. The findings of the investigation are that these controls were not activated to fully lower the stairs.


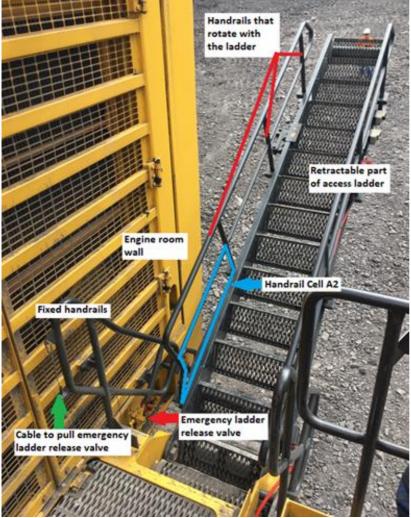


Figure 2 - Retractable ladder parts defined for this bulletin



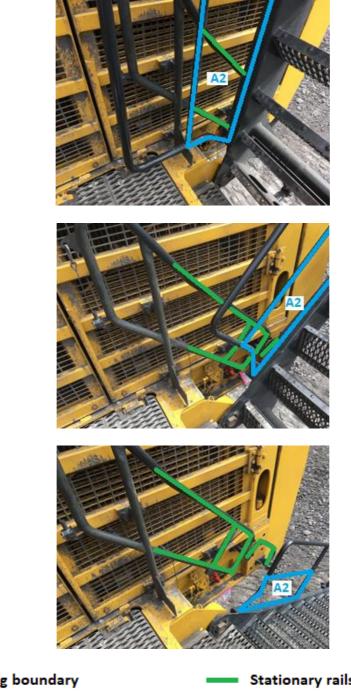

Rotating boundary rails for Cell A2

Stationary rails that cross paths with A2 during rotation

Figure 3 - Scissor action at cross-overs between rotating and stationary handrails



#### Recommendations

The Queensland Coal Inspectorate recommends the following:

• OEMs & mine operators must consider the hazards created by moving ladder parts during the design phase and introduction of plant to site.

The design of access ladders where crush zones are created when the rotating parts pass stationary parts should be reviewed and controls implemented where risk is identified.

The excavator involved in this incident was subsequently modified. Mesh inserts were installed on the rotating handrails to prevent persons accessing the E-Valve and covers were installed over the E-Valve. (See Figure 4)



Figure 4 - Covers and inserts fabricated after the incident

#### • Apply the hierarchy of controls to the design of the E-Valve on mobile equipment.

The procedure, an administrative control, required the ladder to be lowered from a safe location. However, it was physically possible to access the E-Valve directly.

Engineering controls should be applied to isolate the valve and prevent it from being accessed intentionally or inadvertently.

#### • Notification to Standards

Regulator will inform Standards Australia of findings of this investigation for consideration in future versions of standards for heavy vehicle access systems.

#### • Conformance to Standard

For modifications or the purchasing of new equipment, it is recommended that access system designs conform to AS 5327:2019 Earth-moving machinery – Access systems (ISO 2867:2011,MOD)



#### Identify and rectify trip hazards

As part of a risk assessment process, the OEM and mine operator must review access designs to identify and rectify possible trip hazards.

#### Review power supply to the vehicle health monitoring system

It is recommended that if a unit of mobile equipment is fitted with a vehicle health monitoring system, as was the case in this incident, power continues to be supplied to the system after the application of an emergency stop switch.

#### • Maintain three points of contact

Communicate the findings of the investigation to coal mine workers including the importance of effectively maintaining three points of contact whilst using ladders or stairs on any building, plant or equipment.

#### **Additional Observations**

#### No emergency access to excavator - (Central Queensland 2019)

Most large mining excavators have a retractable ladder that provides access to the operator's cabin and maintenance areas. During operations, the ladder is raised and the machine cannot be boarded.

Designs vary, but for normal operation, the movement of the ladder (up or down) is typically controlled with switches. For emergency lowering, a hydraulic valve accessible from ground level or on board is opened. (Figure 5).

# Findings

- Observations by the Inspectorate found that on some models of excavator the ladder cannot be lowered from ground level with the emergency valve unless the engine is running.
- Rescuers from ground level would have difficulty accessing the machine in a timely manner to provide assistance to a person in case of an emergency whereby:
  - The operator is incapacitated
  - The access ladder is raised and is the only means of access
  - The engine is not running





Figure 5 - Pull-chain for the ladder emergency release valve

#### The Queensland Coal Inspectorate recommends the following:

- Inspect each unit of equipment with a retractable access ladder to determine whether the above configuration applies
- Test emergency lowering in all modes of operation;
  - From on board / from ground level
  - With engine running / With engine off
  - Review design and commissioning risk assessment and modify to reflect findings of test program

## Incident Two

# Shovel operator fatally injured by retractable ladder (Western Australia 2018)

A shovel operator was fatally injured when crushed between a retractable hydraulic access ladder and a handrail as he was investigating the cause of an engine power loss. (See Figure 6)

Circles indicate where the accident happened, showing the ladder in the final (left) and upright (middle) positions with the handrail, platform and emergency shutdown (A) and ladder (B) switches.





Figure 6 - Scene of fatality caused by shovel hydraulic access ladder

# Findings

There were no witnesses to the incident.

It appears that the operator was standing to the left of the ladder, attempting to reset the emergency shutdown switch A, which was outboard of the railing. He activated the nearby ladder pull-down wire instead. He was crushed against a stationary handrail when the ladder rotated down.

More information is available in Significant Incident Report 261 by the Western Australian Government. It can be viewed at <a href="https://www.dmp.wa.gov.au/Safety/Mines-safety-alerts-13194.aspx">https://www.dmp.wa.gov.au/Safety/Mines-safety-alerts-13194.aspx</a>

## Recommendations

(As SIR 261)

The following safe systems of work are recommended to mining operations to assist in the safe operation of shovels and excavators:

 Conduct an audit of shovels and excavators on site to identify all configurations of actuated access ladders and stairways that could present a crush hazard to workers accessing emergency switches.

<u>Note</u>: Pay particular attention to machines with rotating ladders and emergency pull-wire switches that could be activated inadvertently, either by personnel or by material falling against the machine.

- Conduct a risk assessment of these potential crush hazards and implement appropriate controls (e.g. safe positioning of switches, clearly labelling all switches and switch positions, providing adequate lighting for all tasks).
- Review standard operating procedures for the operation of shovels and excavators to confirm they include operation and reset of emergency switches.
- Train those using and accessing shovels and excavators in the reviewed standard operating procedures.



## **Incident Three**

# Mine worker injured after falling from grader access ladder (New South Wales 2014)

A coal mine worker at an open cut coal mine sustained spinal injuries when he fell from an access ladder on a grader after it had unexpectedly rotated.





#### **Findings**

The operator was cleaning the grader windows and was standing on the access ladder in the lowered position. When he closed the door, the ladder unexpectedly rotated to the raised position. The operator fell head-first onto the ground, sustaining spinal injuries.

When the door closed, a series of interlocks activated, causing the ladder to rotate. More information is available in Safety Alert SA14-05 by the New South Wales Government. It can be viewed at <a href="https://www.resourcesandgeoscience.nsw.gov.au/miners-and-explorers/safety-and-health/incidents/safety-alerts">https://www.resourcesandgeoscience.nsw.gov.au/miners-and-explorers/safety-and-health/incidents/safety-alerts</a>

#### Recommendations

(As SA14-05)

- Mine operators should consider auditing retractable ladder systems installed on mobile equipment to ensure they are installed and operating in accordance with the ladder manufacturer's recommendations.
- Mine operators should review their risk assessments for mobile equipment fitted with retractable ladder systems to ensure the hazards associated with these systems have been identified, and appropriate controls have been established.
- Mine operators should review operating, maintenance and training procedures for mobile equipment fitted with retractable ladder systems to ensure the controls identified in the risk assessments have been implemented.
- Mine operators should ensure they have a rigorous process for introducing new equipment to site, that includes obtaining and reviewing all relevant safety documentation, including design risk assessments, before mobile equipment is placed into service for the first time.



• Mine operators should ensure that a mine specific operations and maintenance risk assessment is carried out for new mobile plant, and the controls arising from this assessment implemented prior to the introduction of equipment.